

PRO190SL and SLE Mechanical Bearing, Ball-Screw Stage

HARDWARE MANUAL

Revision 2.01



GLOBAL TECHNICAL SUPPORT

Go to the Global Technical Support Portal for information and support about your Aerotech, Inc. products. The website supplies software, product manuals, Help files, training schedules, and PC-to-PC remote technical support. If necessary, you can complete Product Return (RMA) forms and get information about repairs and spare or replacement parts. To get help immediately, contact a service office or your sales representative. Include your customer order number in your email or have it available before you call.

This manual contains proprietary information and may not be reproduced, disclosed, or used in whole or in part without the express written permission of Aerotech, Inc. Product names mentioned herein are used for identification purposes only and may be trademarks of their respective companies.

Copyright © 2016-2023, Aerotech, Inc., All rights reserved.



Table of Contents

PRO190SL and SLE Mechanical Bearing, Ball-Screw Stage Table of Contents List of Figures List of Tables EU Declaration of Incorporation UKCA Declaration of Incorporation Safety Procedures and Warnings Installation and Operation Electrical Warnings Motor-Related Warnings Pinch Points Handling and Storage	3 4 5 6 7 8 9 10 11 12
Chapter 1: Overview11.1. Environmental Specifications11.2. Accuracy and Temperature Effects11.3. Basic Specifications11.4. Vacuum Operation2	17 18 19
Chapter 2: Installation22.1. Dimensions22.2. Securing the Stage to the Mounting Surface22.3. Attaching the Payload to the Stage2	23 28
Chapter 3: Electrical Installation33.1. Motor and Feedback Connectors33.2. Motor and Feedback Wiring33.3. Motor and Feedback Specifications43.4. Limits, Marker, and Machine Direction43.5. Motor and Feedback Phasing4	34 39 41 45
Chapter 4: Maintenance44.1. Service and Inspection Schedule44.2. Cleaning and Lubrication44.3. Motor Mounting54.4. Side Seal Belt Replacement54.5. Foldback Motor Belt Adjustment64.6. Troubleshooting6	49 50 54 57 65
Appendix A: Warranty and Field Service	
Appendix B: Revision History 7	71
Index 7	73

List of Figures

Figure 2-1:	PRO190SL Dimensions	
Figure 2-2:	PRO190SL Tabletop Dimensions (-TT2/-TT3 Option)	24
Figure 2-3:	PRO190SLE Dimensions	25
Figure 2-4:	PRO190SLE Tabletop Dimensions (-TT3)	
Figure 2-5:	Z-Axis Bracket Dimensions	27
Figure 2-6:	Stage Orientations	
Figure 2-7:	Cantilevered Load Capability	
Figure 2-8:	Load Torque Equation	
Figure 2-9:	Torque Required to Turn Ball Screw in Vertical Orientation	
Figure 3-1:	Brushless Motor and Feedback Wiring [-SL Option]	
Figure 3-2:	Brushless Motor and Feedback Wiring [-SLE Option]	40
Figure 3-3:	Machine Direction	45
Figure 3-4:	Hall Phasing Diagram	
Figure 3-5:	Encoder Phasing Reference Diagram (Standard/Square Wave)	
Figure 3-6:	Digital Encoder Phasing Reference Diagram (Sine Wave)	
Figure 4-1:	Hardcover Rear End Plate Removal	
Figure 4-2:	Hardcover Screw Removal	
Figure 4-3:	Hardcover Removal	53
Figure 4-4:	Motor Mounting Overview	54
Figure 4-5:	Attach the Coupling Adapter to the Motor Shaft	55
Figure 4-6:	Attach the Motor the Stage	55
Figure 4-7:	Tighten the Shaft Coupling to the Drive Screw	
Figure 4-8:	Belt Removal at the Attachment Pins	58
Figure 4-9:	Spring Location Detail	59
Figure 4-10:	Pull Through Method	60
Figure 4-11:	Stage Table Cover Plate Removal	61
Figure 4-12:	Manual Feed Method	62
Figure 4-13:	Belt Wrap	62
Figure 4-14:	Belt Alignment	63
Figure 4-15:		
Figure 4-16:	Foldback Motor Cover Removal	66
Figure 4-17:	Foldback Motor Part Callouts	67
Figure 4-18:	Lubricate the Pulley Flanges	67

List of Tables

Table 1-1:	Model Numbers and Ordering Options	. 15
Table 1-2:	Environmental Specifications	17
Table 1-3:	PRO190SL/SLE Series Specifications (-050 to -250)	19
Table 1-4:	PRO190SL/SLE Series Specifications (-300 to -800)	20
Table 2-1:	Stage Mounting Surface Flatness Requirement	28
Table 2-2:	Stage to Mounting Surface Hardware	. 28
Table 2-3:	Payload Mounting Surface Flatness Requirement	. 29
Table 3-1:	Brushless Motor Connector Pinout	35
Table 3-2:	Mating Connector Part Numbers for the Brushless Motor Connector	35
Table 3-3:	Brushless Motor Feedback Connector Pinout	. 36
Table 3-4:	Mating Connector Part Numbers for the Brushless Motor Feedback Connector	36
Table 3-5:	Linear Encoder Connector Pinout (-SLE only)	. 37
Table 3-6:	Mating Connector Part Numbers for the Encoder Connector	37
Table 3-7:	Limit Connector Wiring	38
Table 3-8:	Mating Connector Part Numbers for the Limit Connector	38
Table 3-9:	Hall-Effect Sensor Specifications	41
Table 3-10:	Thermistor Specifications (BMS Motor Options)	41
Table 3-11:	Encoder Specifications	41
Table 3-12:	Rotary Encoder Resolution Specifications	41
Table 3-13:	Linear Encoder Resolution Specifications	42
Table 3-14:	Limit Switch Specifications	
Table 3-15:	Brake Specifications	42
Table 3-16:	PRO190SL/SLE Motor Specifications (BMS100)	43
Table 3-17:	PRO190SL/SLE Motor Specifications (BM130)	44
Table 4-1:	Hardware Requirements	54
Table 4-2:	Side Seal Belt Replacement Kit Ordering Guide	57

EU Declaration of Incorporation

Manufacturer

Aerotech, Inc. 101 Zeta Drive Pittsburgh, PA 15238-2811 USA

(F

herewith declares that the product:

PRO190SL/SLE stage

is intended to be incorporated into machinery to constitute machinery covered by the Directive 2006/42/EC as amended; and that the following harmonized European standards have been applied:

EN ISO 12100:2010

Safety of Machinery - Basic concepts, general principles for design EN 60204-1:2010 Safety of Machinery - Electrical equipment of machines - Part 1: General requirements

and further more declares that

it is not allowed to put the equipment into service until the machinery into which it is to be incorporated or of which it is to be a component has been found and declared to be in conformity with the provisions of the Directive 2006/42/EC and with national implementing legislation, for example, as a whole, including the equipment referred to in this Declaration.

This is to certify that the aforementioned product is in accordance with the applicable requirements of the following directive(s):

EU 2015/863

Directive, Restricted Substances (RoHS 3)

Representative:

/ Norbert Ludwig

Managing Director Aerotech GmbH Gustav-Weißkopf-Str. 18 90768 Fürth

Engineer Verifying Compliance

Authorized

(llox Nohrenber / Alex Weibel

Germany

Aerotech, Inc. 101 Zeta Drive Pittsburgh, PA 15238-2811 USA 7/20/2023

Date

UKCA Declaration of Incorporation

Manufacturer

Aerotech, Inc. 101 Zeta Drive Pittsburgh, PA 15238-2811 USA



herewith declares that the product:

PRO190SL/SLE stage

To which this declaration relates, meets the essential health and safety requirements and is in conformity with the relevant UK Legislation listed below:

Supply of Machinery (Safety) Regulations 2008

Hazardous Substances in Electrical and Electronic Equipment Regulations 2012

Using the relevant section of the following UK Designated Standards and other normative documents when installed in accordance with the installation instructions supplied by the manufacturer.

EN ISO 12100:2010 Safety of Machinery - Basic concepts, general principles for design EN 60204-1:2010 Safety of Machinery - Electrical equipment of machines - Part 1: General requirements

and furthermore declares that it is not allowed to put the product into service until the machinery into which it is to be incorporated or of which it is to be a component has been found and declared to be in conformity with the provisions of the Supply of Machinery (Safety) Regulations 2008 UK Legislation and with national implementing legislation, for example, as a whole, including the equipment referred to in this Declaration.

Authorized Representative:

/ Simon Smith

Managing Director Aerotech Ltd The Old Brick Kiln, Ramsdell, Tadley Hampshire RG26 5PR UK

Engineer Verifying Compliance

(llox Minerby / Alex Weibel

Aerotech, Inc. 101 Zeta Drive Pittsburgh, PA 15238-2811 USA 7/20/2023

Date

Safety Procedures and Warnings

IMPORTANT: This manual tells you how to carefully and correctly use and operate the stage.

• Read all parts of this manual before you install or operate the stage or before you do maintenance to your system.



- To prevent injury to you and damage to the equipment, obey the precautions in this manual.
- All specifications and illustrations are for reference only and were complete and accurate as of the release of this manual. To find the newest information about this product, refer to www.aerotech.com.

If you do not understand the information in this manual, contact Aerotech Global Technical Support.

IMPORTANT: This product has been designed for light industrial manufacturing or laboratory environments. If the product is used in a manner not specified by the manufacturer:

- The protection provided by the equipment could be impaired.
- The life expectancy of the product could be decreased.

Safety notes and symbols are placed throughout this manual to warn you of the potential risks at the moment of the safety note or if you fail to obey the safety note.



Shock/Electrocution Hazard



General/Conditional Awareness



Hot Surface Hazard



Magnetic Field Hazard



Heavy, Bulky Lifting Hazard



Pressure/Explosive Atmosphere Hazard



Trip Hazard



Appropriate Equipment Required

Pinch, Shear, or Crush Hazard

Rotational Machinery Hazard

Pinch/Entanglement Hazard



Electrostatic Discharge Hazard

A blue circle symbol is an action or tip that you should obey. Some examples include:



General tip

Wear personal protective equipment (PPE): Safety Glasses



Wear personal protective equipment (PPE): Gloves



Read the manual/section



If applicable, do not lift unassisted



Wear personal protective equipment (PPE): Hearing Protection

Installation and Operation

To decrease the risk of damage to the equipment, you must obey the precautions that follow.

DANGER: General Hazard Warning!

This product can produce high forces and move at velocities that could cause injury. The user is responsible for its safe operation. The following general equation is provided to assist with risk assessments in regards to contact and pinch points:

$$Pressure_{Max}\left[rac{N}{mm^2}
ight] = rac{Force_{Peak}[N]}{Area_{Contact}[mm^2]}$$

WARNING: General Hazard Warning!

- Only trained operators should operate this equipment.
- All service and maintenance must be done by approved personnel.
- Use this product only in environments and operating conditions that are approved in this manual.
- Never install or operate equipment that appears to be damaged.
- On stages with BMS motors: the motor over-temperature sensor must be monitored by the drive. Use it to shut down the drive if the motor overheats.
- Make sure that the product is securely mounted before you operate it.
- Make sure that all pneumatic lines are securely connected.
- Use care when you move the stage or you could negatively affect the performance of it.



WARNING: Trip Hazard!

Route, house, and secure all cables, duct work, air, or water lines. Failure to do so could introduce trip hazards around the system that could result in physical injury or could damage the equipment.

Electrical Warnings

To decrease the risk of electrical shock, injury, death, and damage to the equipment, obey the precautions that follow.

DANGER: Electrical Shock Hazard!

- Stage motor phase voltage levels could be hazardous live.
- Personnel are protected from hazardous voltages unless electrical interconnections, protective bonding (safety ground), or motor/stage enclosures are compromised.
- Do not connect or disconnect stage/motor interconnections while connected to a live electrical power source.
- Before you set up or do maintenance, disconnect electrical power.
- It is the responsibility of the End User/System Integrator to make sure that stages are properly connected and grounded per Engineering Standards and applicable safety requirements.
- It is the responsibility of the End User/System Integrator to configure the system drive or controller within the Aerotech motor/stage electrical and mechanical specifications.



Motor-Related Warnings

Aerotech motors are capable of producing high forces and velocities. Obey all warnings and all applicable codes and standards when you operate a system that incorporates Aerotech motors.

DANGER: Mechanical Hazard!


Personnel must be made aware of the mechanical hazards during set up or when you do service to the stage.

- Unintentional manual movement into the stage "end-of-travel" stops, could damage the stage or undo precision alignments.
- Stage movement could create pinch points, entanglement hazards, or rotational mechanical hazards.

DANGER: Hot Surface Hazard!

- The stage/motor frame temperature could exceed 70°C in some applications.
- Do not touch the stage/motor frame while it is in operation.
- Wait until the stage/motor has cooled before you touch it.

Figure 1: Motor Location

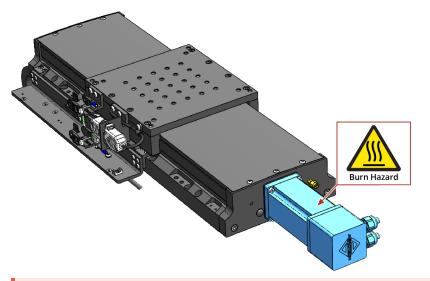



DANGER: Risk in Explosive Atmosphere!

- Standard Aerotech stage/motors are not rated for applications with explosive atmospheres such as airborne dust or combustible vapors.
- Do not operate stage/motors outside of Aerotech environmental specifications.

DANGER: Magnetic Field Hazard!

Aerotech stage/motors contain magnets which can present a Magnetic Field Hazard.

- Do not disassemble a stage motor under any circumstances.
- Strong magnetic fields could interfere with external/internal medical devices.
- Strong magnetic fields could present mechanical hazards such as pinch points.


Pinch Points

A pinch point is a mechanical hazard that can occur when there are exposed parts of the stage or system that can move. For example, the travel of a stage tabletop could expose the user to a pinch point between the tabletop and the stage housing. The images that follow will show you typical external and internal pinch point locations.

DANGER: Mechanical Hazard!

- System travel can cause crush, shear, or pinch injuries.
- Only trained operators should operate this equipment.
- Do not put yourself in the travel path of machinery.
- Restrict access to all motor and stage parts
 - when the system moves under power (during normal operation, for example).
 - when the system is moved manually (during the installation process or when you do maintenance, for example).
- Motors are capable of very high speeds and acceleration rates.

Figure 2: Typical Pinch Point Locations

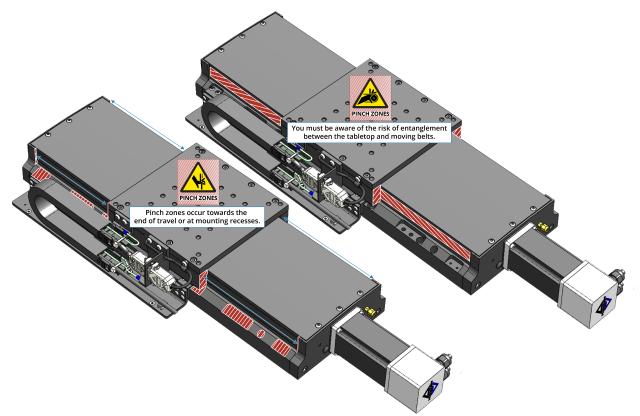

Handling and Storage

IMPORTANT: It is the responsibility of the customer to safely and carefully lift and move the stage.

- Be careful when you move or transport the stage.
- Retain the shipping materials for future use.
- Transport or store the stage in its protective packaging.

WARNING: Electrostatic Discharge (ESD) Sensitive Components!



Wear an ESD wrist strap when you handle, install, or do service to the system assembly.

You could damage the power supply or drives if you fail to observe the correct ESD practices.

Inspect the shipping container for any evidence of shipping damage. If any damage exists, notify the shipping carrier immediately.

Remove the packing list from the shipping container. Make sure that all the items specified on the packing list are contained within the package.

The documentation for the stage is on the included installation device. The documents include manuals, interconnection drawings, and other documentation pertaining to the system. Save this information for future reference.

Each stage has a label listing the system part number and serial number. These numbers contain information necessary for maintenance or system hardware and software updates. Locate this label and record the information for later reference.

Unpacking and Handling

It is the responsibility of the customer to safely and carefully lift and move the stage.



IMPORTANT: All electronic equipment and instrumentation is wrapped in antistatic material and packaged with desiccant. Ensure that the antistatic material is not damaged during unpacking.

DANGER: Lifting Hazard! Use care when you move the stage or you could negatively affect the performance of it.



- Use the correct lifting techniques, mechanical assistance, or additional help to lift or move this product.
- Do not use the cables or the connectors to lift or move this product.
- Make sure that all moving parts are secure before you move the stage. Unsecured moving parts could shift and cause injury or damage to the equipment.
- If the stage is heavy, a single person lift could cause injury. Use assistance when you lift or move it.
 - Refer to Section 2.1. Dimensions for dimensions
 - Refer to Section 1.3. Basic Specifications for weight specifications.

Carefully remove the stage from its protective shipping container.

- Lift this product only by the base.
- Use lifting hardware if it has been provided (refer to Figure 3).
- For multi-axis assemblies, always lift the system by the lower axis.
- Use a cart, dolly, or similar device to move the stage to a new location.

Gently set the stage on a smooth, flat, and clean surface. Use compressed nitrogen or clean, dry, oil-free air to remove any dust or debris that has collected during shipping.


Before you operate the stage, let it stabilize at room temperature for at least 12 hours. This will ensure that all of the alignments, preloads, and tolerances are the same as they were when they were tested at Aerotech.

Each stage has a label listing the system part number and serial number. These numbers contain information necessary for maintenance or system hardware and software updates. Locate this label and record the information for later reference.

Lifting Features

The lifting kit includes four eyebolts and four standoffs. Thread the eyebolts onto the standoffs and thread the standoffs into the stage base. Remove the lifting hardware by turning a wrench on the flats of the standoffs (see Figure 3). If the stage is part of a multi-axis system, the lifting hardware should be attached to the lower axis. The lifting hardware must be removed before the stage can be operated.

Figure 3: Lifting Features

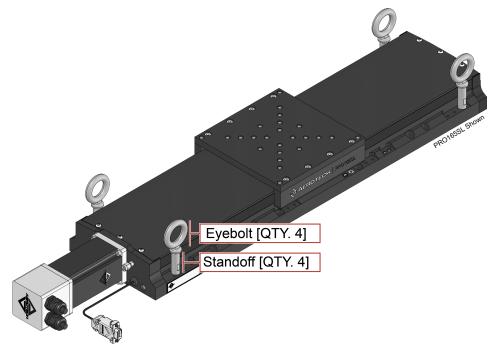

Storage

Store the stage in the original shipping container. If the original packaging included ESD protective packaging, make sure to store the stage in it. The storage location must be dry, free of dust, free of vibrations, and flat.

Refer to Section 1.1. Environmental Specifications

Chapter 1: Overview

Table 1-1: Model Numbers and Ordering Options

PRO190SL and PRO190SLE Series Linear Ball-Screw Stage						
	edback (-SLE only)					
-E1	Incremental linear encoder; 1 Vpp					
-E2	ncremental linear encoder; 0.1 μm digital RS422 output					
-E3	Absolute linear encoder; EnDat 2.2					
-E4	Incremental linear encoder; 0.5 µm digital RS422 output					
Travel (Required						
-050	50 mm travel stage					
-100	100 mm travel stage					
-150	150 mm travel stage					
-200	200 mm travel stage					
-250	250 mm travel stage					
-300	300 mm travel stage					
-400	400 mm travel stage					
-500	500 mm travel stage					
-600	600 mm travel stage					
-800	800 mm travel stage					
Mounting Orient	tation (Required)					
	Normal mounting orientation					
-MT1	Side-mounted or vertical orientation					
-MT2	Inverted mounting orientation					
Tabletop (Option	nal for SL Stages; Required for SLE Stages)					
-TT1	Tabletop with metric dimension mounting					
-TT2	Tabletop with English dimension mounting					
-TT3	Accessory tabletop with mounting for select rotary stages					
-TT4	Tabletop with metric dimension mounting and wiper brushes					
-TT5	Tabletop with English dimension mounting and wiper brushes					
-TT6	Accessory tabletop with mounting pattern for select rotary stages and wipers					
NOTE: -TT1 option r	equired for lower axis of XY (SLE only)					
Motor (Optional)						
-M1	BMS100 brushless servomotor and 2500-Line digital RS422 encoder					
-M2	BMS100 brushless servomotor, 2500-Line digital RS422 encoder, and brake					
-M3	BMS100 brushless servomotor and 1000-Line 1 Vpp encoder					
-M4	BMS100 brushless servomotor, 1000-Line 1 Vpp encoder, and brake					
-M5	BM130 brushless servomotor, 2500-Line 1 Vpp encoder, and brake					
-M6	BM130 brushless servomotor, 2500-Line digital RS422 encoder, and brake					
-M7	BM130 brushless servomotor and 1000-Line 1 Vpp encoder					
-M8	BM130 brushless servomotor, 1000-Line 1 Vpp encoder, and brake					
L						

PRO190SL and P	RO190SLE Series Linear Ball-Screw Stage (continued)					
Foldback (Option						
-FB1	Foldback kit for 1/4" diameter shaft NEMA 23 motor					
-FB2	Foldback kit with brake for 1/4" diameter shaft NEMA 23 motor					
-FB3	Foldback kit for 3/8" diameter shaft NEMA 23 motor					
-FB4	Foldback kit with brake for 3/8" diameter shaft NEMA 23 motor					
Motor Orientatio						
-2	Bottom cable exit, optional orientation					
-3	Left-side cable exit, standard orientation					
-4	Top cable exit, optional orientation					
-5	Right-side cable exit, optional orientation					
-8	Right-side foldback, standard orientation					
-12	Left-side foldback, optional orientation					
Limits (Required						
-LI1	Normally-closed limit switches; 5 VDC with 9-pin D connector					
-LI2	Normally-open limit switches; 5 VDC with 9-pin D connector					
-LI3	Normally-closed limit switches; 24 VDC with 9-pin D connector					
Coupling (Option						
-CP1	Coupling for 1/4" diameter shaft					
-CP2	Coupling for 3/8" diameter shaft					
Lifting Hardware						
-LF	Lifting hardware					
NOTE: Lifting option XY set (only order or	n only available on travels 400 mm and greater. Lifting should never be ordered on the upper-axis of an n lower-axis).					
ThermoComp™ (
-TCMP	ThermoComp [™] integrated thermal compensation unit, single or lower axis					
NOTE: You must use	e an Automation1 or A3200 controller with the -TCMP option.					
Metrology (Requ	ired)					
-PLO	No metrology performance plots					
-PL1	Uncalibrated with performance plots					
-PL2	Calibrated with performance plots					
Accessories (To I	oe Ordered as a Separate Line Item)					
ALIGN-NPA	Non-precision XY assembly					
ALIGN-NPAZ	Non-precision XZ or YZ assembly					
ALIGN-PA10	XY assembly; 10 arc sec orthogonality; alignment to within 7 μm orthogonality for short travel stages					
ALIGN-PA10Z	XZ or YZ assembly with L-bracket; 10 arc second orthogonality; alignment to within 10 μm orthogonality for short travel stages					
ALIGN-PA5	XY assembly; 5 arc sec orthogonality; alignment to within 3 µm orthogonality for short travel stages					
ALIGN-PA5Z	XZ or YZ assembly with L-bracket; 5 arc second orthogonality; alignment to within 5 μm orthogonality for short travel stages					
HDZ190	Right angle L-bracket for 50 mm, 100 mm, and 150 mm travels only					
	requires a tabletop when mounting to a PRO series stage.					

1.1. Environmental Specifications



WARNING: **General Hazard Warning!** Do not expose this product to environments or conditions outside of the listed specifications. You could damage the equipment if you exceed the environmental or operating specifications.

DANGER: Risk in Explosive Atmosphere!

- Standard Aerotech stage/motors are not rated for applications with explosive atmospheres such as airborne dust or combustible vapors.
- Do not operate stage/motors outside of Aerotech environmental specifications.

Ambient	Operating: 10° to 35° C (50° to 95° F)
Temperature	The optimal operating temperature is 20° C \pm 2° C (68° F \pm 4° F). If at any time the operating temperature deviates from 20° C degradation in performance could occur.
	Storage: 0° to 40° C (32° to 104° F) in original shipping packaging
Humidity	Operating: 20% to 60% RH
	Storage: 10% to 70% RH, non-condensing in original packaging.
	The stage should be packaged with desiccant if it is to be stored for an extended time.
Altitude	Operating: 0 m to 2,000 m (0 ft to 6,562 ft) above sea level
	Contact Aerotech if your specific application involves use above 2,000 m or below sea level.
Vibration	Use the system in a low vibration environment. Floor or acoustical vibration can affect system performance. Contact Aerotech for information regarding your specific application.
Protection Rating	These stages have limited protection against dust, but not water. This equates to an ingress protection rating of IP50.
Use	Indoor use only

Table 1-2: Environmental Specifications

1.2. Accuracy and Temperature Effects

Aerotech products are designed for and built in a 20°C (68°F) environment. Temperature changes could cause a decrease in performance or permanent damage to the stage. At a minimum, the environmental temperature must be controlled to within 0.25°C per 24 hours to ensure the stage specifications are repeatable over an extended period of time. The severity of temperature effects on all specifications depends on many different environmental conditions, which include how the stage is mounted. Contact the factory for more details.

The accuracy specification of stage is measured 25 mm above the table with the stage in an unloaded condition. The stage is assumed to be fully supported by a mounting surface meeting or exceeding the specification in Section 2.2.

The accuracy of the screw is a key element in the overall positioning accuracy of the SL stage. A scale error can be expected if temperature of the screw differs from 20° C (68° F). The greater the temperature difference, the greater the error. The temperature of the screw depends on the speed and duty cycle of the stage. The faster the movement and higher the duty cycle, the more the stage accuracy will be affected by heat. The thermal expansion coefficient of the screw is 11.7 ppm/°C.

SLE stages contain a linear encoder for direct feedback of the carriage position. The stage travel as seen by the linear encoder will expand at the rate of 3.25 ppm/°C as the temperature of the encoder scale deviates from 20°C.

The ThermoComp[™] option is a hardware and software solution that uses the functionality of the Automation1 or A3200 controller to mitigate the effects of changing temperature by detecting and compensating for thermal changes. ThermoComp[™] is effective at compensating for both selfheating and environmental temperature changes.

1.3. Basic Specifications

Resolution is dependent on screw pitch, encoder resolution, and controller interpolation.

Table 1-3: PRO190SL/SLE Series Specifications (-050 to -250)

Table I-5. FRO	1903	SEL Series S		-	-	-		
			-050	-100	-150	-200	-250	
Travel			50 mm	100 mm	150 mm	200 mm	250 mm	
	SL	Standard	±6 μm	±6 μm	±7 μm	±8 µm	±9 µm	
Accuracy ⁽¹⁾	SL	Calibrated	±1 μm	±1 μm	±1 μm	±1 μm	±1.5 μm	
Accuracy	SLE	Standard	±3 μm	±4 μm	±6 μm	±8 µm	±9 µm	
	JLL	Calibrated	±1 µm	±1 μm	±1 μm	±1 μm	±1 µm	
Resolution (Minimum	SL			0.1	μm ⁽²⁾ , 1.0 μn	n ⁽³⁾		
Incremental Motion)	SLE		0.05 µm	(-E1/-E3 encod	ler), 0.2 µm (-E encoder)	E2 encoder), 1.	0 µm (-E4	
Bidirectional	SL				±1 μm			
Repeatability ⁽¹⁾	SLE				±0.5 μm			
Horizontal Straight	tness ⁽¹⁾		±1.5 μm	±2.5 μm	±2.5 μm	±2.5 μm	±3 μm	
Vertical Straightne	ss ⁽¹⁾		±1.5 μm	±2.5 μm	±2.5 μm	±2.5 μm	±3 μm	
Ditch			19 µrad	27 µrad	29 µrad	40 µrad	45 µrad	
Pitch			(3.9 arc sec)	(5.6 arc sec	(6 arc sec)	(8.2 arc sec)	(9.3 arc sec)	
		19 µrad	27 µrad	29 µrad	40 µrad	45 µrad		
Roll			(3.9 arc sec)	(5.6 arc sec)	(6 arc sec)	(8.2 arc sec)	(9.3 arc sec)	
		19 µrad	27 µrad	29 µrad	40 µrad	45 µrad		
Yaw			(3.9 arc sec)	(5.6 arc sec)	(6 arc sec)	(8.2 arc sec)	(9.3 arc sec)	
Ball Screw Lead			5 mm/rev					
Maximum Speed ⁽⁴	1)		300 mm/s					
Maximum Accelera	ation ⁽⁴⁾		Function of motor, amplifier, payload, and maximum axial load					
	Horizo	ontal	60 kg					
Load Capacity ⁽⁵⁾	Vertica	al (Axial)	50 kg					
	Side		60 kg					
Moving Mass	oving Mass SL			3.7 kg				
(with tabletop)	oletop) SLE 3.9 kg							
Stage Mass	SL		10.2 kg	11.2 kg	12.0 kg	12.8 kg	13.7 kg	
(no motor)	SLE		10.8 kg	11.7 kg	12.6 kg	13.6 kg	14.5 kg	
Material	•		Anodized Aluminum					
Mean Time Before	Failure (MTBF)			20,000 Hours	5		

1. Certified with -PL1 and -PL2 option.

2. Achieved with Aerotech rotary motor with amplified sine encoder.

3. Achieved with Aerotech rotary motor with 2500 counts/rev digital encoder.

4. Requires the selection of an applicable amplifier with sufficient voltage and current.

5. Axis orientation for on-axis loading is listed.

6. Specifications are for single-axis systems measured 25 mm above the tabletop; performance of multi-axis system depend upon the payload and workpoint. Consult the Aerotech factory for multi-axis or non-standard applications.7. Specifications listed are non-foldback kit options. Contact the factory for specifications when a foldback kit (-FBx) is used.

Table 1-4: PRO190SL/SLE Series Specifications (-300 to -800)

			-300	-400	-500	-600	-800	
Travel			300 mm	400 mm	500 mm	600 mm	800 mm	
		Standard	±9.5 μm	±11 μm	±13 μm	±15 μm	±17 μm	
Accuracy ⁽¹⁾	SL	Calibrated	±1.5 µm	±1.5 μm	±2 μm	±2 μm	±2.5 µm	
Accuracy	CLE	Standard	±10 µm	±12 µm	±14 μm	±15.5 µm	±17 µm	
	SLE	Calibrated	±1 µm	±1 µm	±1.5 μm	±1.5 µm	±1.5 µm	
Resolution (Minimum	SL			0.1 μm ⁽²⁾ , 1.0 μm ⁽³⁾				
Incremental Motion)	SLE		0.05 µm	(-E1/-E3 encoc	ler), 0.2 µm (-E encoder)	E2 encoder), 1	.0 µm (-E4	
Bidirectional	SL				±1 µm			
Repeatability ⁽¹⁾	SLE		±0.5 μm	±0.5 μm	±0.5 µm	±0.5 μm	±0.75 μm	
Horizontal Straight	ness ⁽¹⁾		±3.5 μm	±4.5 μm	±5.5 μm	±6.5 μm	±8 µm	
Vertical Straightne	ss ⁽¹⁾		±3.5 μm	±4.5 µm	±5.5 μm	±6.5 µm	±8 µm	
			50 µrad	60 µrad	70 µrad	80 µrad	90 µrad	
Pitch			(10.3 arc	(12.4 arc	(14.4 arc	(16.5 arc	(18.6 arc	
			sec)	sec)	sec)	sec)	sec)	
Roll		50 µrad	60 µrad	70 µrad	80 µrad	90 µrad		
		(10.3 arc	(12.4 arc	(14.4 arc	(16.5 arc	(18.6 arc		
		sec)	sec)	sec)	sec)	sec)		
		50 µrad	60 µrad	70 µrad	80 µrad	90 µrad		
Yaw			(10.3 arc	(12.4 arc	(14.4 arc	(16.5 arc	(18.6 arc	
			sec)	sec)	sec)	sec)	sec)	
Ball Screw Lead					5 mm/rev			
Maximum Speed ⁽⁴					300 mm/s			
Maximum Accelera	ation ⁽⁴⁾		Function of motor, amplifier, payload, and maximum axial load					
	Horizo	ontal	60 kg					
Load Capacity ⁽⁵⁾	Vertical (Axial)		50 kg					
	Side		60 kg					
Moving Mass	SL		3.7 kg					
(with tabletop)	SLE 3.9			3.9 kg				
Stage Mass	SL		14.6 kg	16.3 kg	18.1 kg	19.9 kg	23.3 kg	
(no motor)	SLE		15.4 kg	17.2 kg	19.1 kg	20.9 kg	24.6 kg	
Material			Anodized Aluminum					
Mean Time Before	Failure	(MTBF)			20,000 Hours	;		
	1							

1. Certified with -PL1 and -PL2 option.

2. Achieved with Aerotech rotary motor with amplified sine encoder.

3. Achieved with Aerotech rotary motor with 2500 counts/rev digital encoder.

4. Requires the selection of an applicable amplifier with sufficient voltage and current.

5. Axis orientation for on-axis loading is listed.

6. Specifications are for single-axis systems measured 25 mm above the tabletop; performance of multi-axis system

depend upon the payload and workpoint. Consult the Aerotech factory for multi-axis or non-standard applications.

7. Specifications listed are non-foldback kit options. Contact the factory for specifications when a foldback kit (-FBx) is used.

1.4. Vacuum Operation

There are two vacuum preparation options:

- Low Vacuum (for use in atmospheric pressures down to 10⁻³ Torr)
- High Vacuum (preparation for environments from 10⁻³ Torr down to 10⁻⁶ Torr).

Special preparations include:

- Parts are lubricated with vacuum-compatible lubricants.
- Materials, fasteners, and coatings are selected to be compatible with the specified level of vacuum.
- High-vacuum systems are designed to eliminate trapped volumes.
- Prior to assembly, stage parts are thoroughly cleaned in a clean environment.
- The stage is packaged in a special polyethylene bag.

Vacuum Guidelines

To ensure that the stage will continue to perform well in the vacuum environment, use the guidelines that follow (in addition to standard handling, installation, and lubrication guidelines outlined in this manual).

- 1. Do not remove the stage from its sealed bag until it is ready to use.
- 2. Always handle the stage in a clean environment and use powder-free polyethylene gloves to prevent any contaminants from adhering to the surface of the stage.
- 3. During installation, use cleaned, vented, stainless steel fasteners to secure the stage.
- 4. Reduced air pressure eliminates significant convective heat transfer. This, coupled with the viscous vacuum-compatible lubricants, could result in excessive motor operating temperatures. Because of this, consider all continuous torque ratings to be 40 to 60% lower than the value specified for operation in normal atmospheric environment. Reduce motor usage accordingly.
- 5. We recommend that you use a small quantity of Braycote® 602EF grease or a compatible substitute of equal quality lubricant in vacuum applications.
- 6. To reduce outgassing during the initial pump-down to vacuum pressure, Aerotech recommends that you bake out vacuum systems when you first install them into the vacuum chamber. Bake the vacuum components at 60 °C for 24 to 48 hours to desorb water vapor from surfaces and degas polymers (such as cable insulation).

This page intentionally left blank.


Chapter 2: Installation



IMPORTANT: The stage installation must be in accordance with the instructions provided by this manual and any accompanying documentation. Failure to follow these instructions could result in injury or damage to the equipment.

2.1. Dimensions



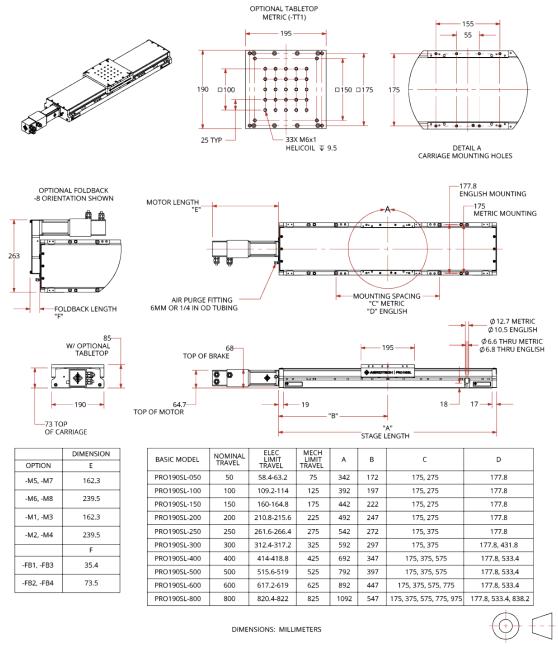


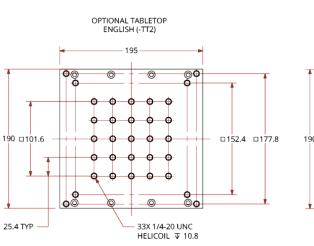



Figure 2-2: PRO190SL Tabletop Dimensions (-TT2/-TT3 Option)



-TT3					
MOUNTS THE FOLLOWING					
ADRS	ADRT	AGR			
-150	-150	-100			
-200					

DIMENSIONS: MILLIMETERS

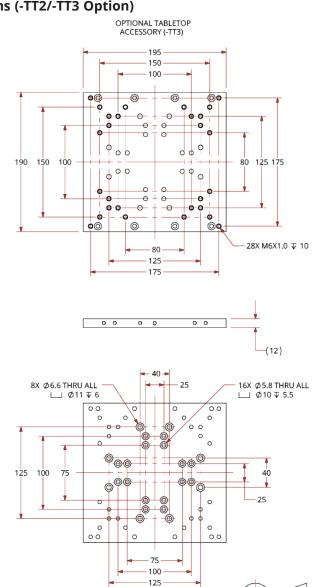

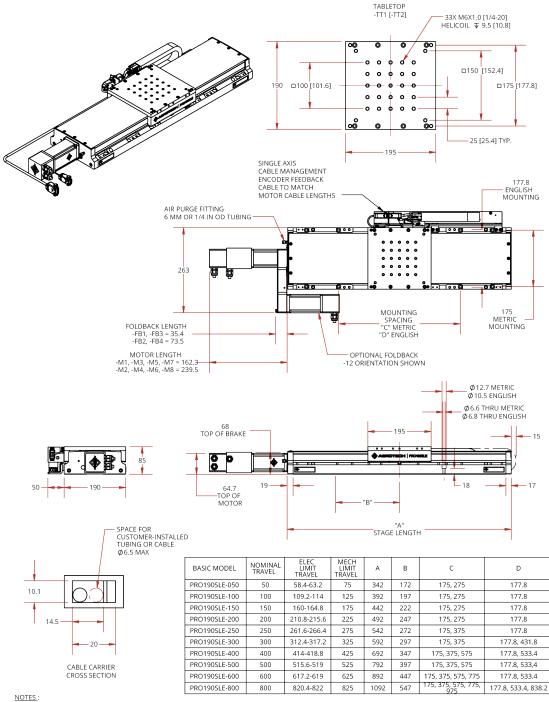

1. DIMENSIONS: MILLIMETERS.




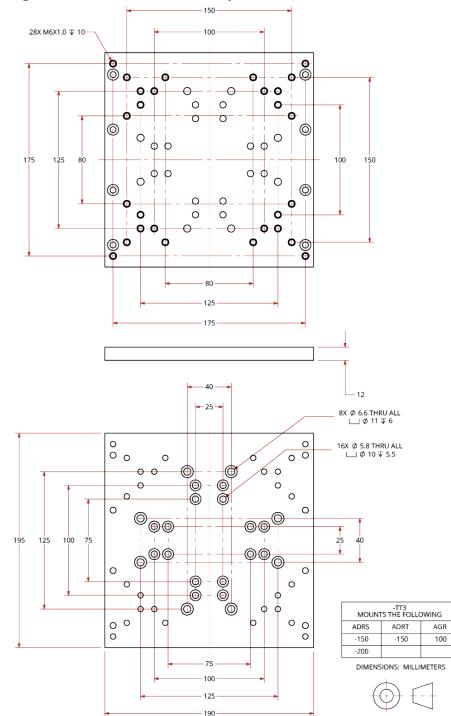


Figure 2-4: PRO190SLE Tabletop Dimensions (-TT3)

Figure 2-5: Z-Axis Bracket Dimensions

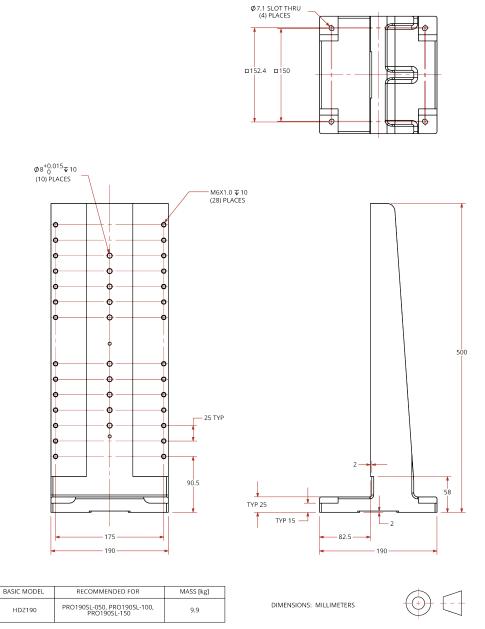

2.2. Securing the Stage to the Mounting Surface

DANGER: Mechanical Hazard!



- Personnel must be made aware of the mechanical hazards during set up or when you do service to the stage.
- Do not manually move the stage if it is connected to a power source.
- The stage must be mounted securely. Improper mounting can result in injury and damage to the equipment.
- When you move the tabletop manually to do maintenance, this could expose the operator to pinch points. Refer to Pinch Points on Page 12.

The mounting surface must be flat and have adequate stiffness to achieve the maximum performance from the stage. When it is mounted to a non-flat surface, the stage can be distorted while the mounting screws are tightened. This distortion will decrease overall accuracy. Adjustments to the mounting surface must be done before the stage is secured.

Inspect the mounting surface for dirt or unwanted residue and clean if necessary. Use precision flatstones on the mounting surface to remove any burrs or high spots. Clean the mounting surface with a lint-free cloth and acetone or isopropyl alcohol and allow the cleaning solvent to completely dry. Gently place the stage on the mounting surface.



IMPORTANT: The stage is precision machined and verified for flatness prior to product assembly at the factory. If machining is required to achieve the desired flatness, it should be performed on the mounting surface rather than the stage. Shimming should be avoided if possible. If shimming is required, it should be minimized to retain maximum rigidity of the system.

Table 2-1: Stage Mounting Surface Flatness Requirement

	0	0	•	
Stage Travel				Flatness Requirement
All Travels				7.5 µm

If necessary, manually move the stage table to access the mounting holes along the edges of the stage. This stage is designed to use socket head cap screws (SHCS) to secure the base to the mounting surface.

.

IMPORTANT: The stage table may offer a considerable amount of resistance when it is moved manually.

• Do not attempt to manually move the stage if it is connected to a power source or includes an integrated brake.

Tightening torque values for the mounting hardware are dependent on the properties of the surface to which the stage is being mounted. Values provided in Table 2-2 are typical values and may not be accurate for your mounting surface. Refer to Section 2.1. for mounting locations and dimensions.

Table 2-2: Stage to Mounting Surface Hardware

Mounting Hardware	Typical Screw Torque
M6 x 30 mm (or 1/4" x 1-1/8") SHCS with flat washers	7 N·m [5 ft·lb]

2.3. Attaching the Payload to the Stage

Inspect the mounting surface for dirt or unwanted residue and clean if necessary. Clean the mounting surface with a lint-free cloth and acetone or isopropyl alcohol and allow the cleaning solvent to completely dry. Gently place the stage on the mounting surface.

Use a representative payload during start-up to prevent accidental damage to the stage and the payload. Proceed with the electrical installation and test the motion control system in accordance with the system documentation. Document all results for future reference. For information on electrical installation refer to Chapter 3: Electrical Installation and the documentation delivered with the stage.



IMPORTANT: If your PRO190SL/SLE was purchased with Aerotech controls, it could have been tuned with a representative payload based on the information provided at the time of order. If you start the PRO190SL/SLE without a payload, the servo gains provided by Aerotech with the shipment may not be appropriate and servo instability can occur. Refer to the controller help file for tuning assistance.

The payload must be flat, rigid, and comparable to the stage in quality to maintain optimum performance.


Table 2-3: Payload Mounting Surface Flatness Requirement

Stage Travel	Flatness Requirement
All Travels	12 µm

WARNING: General Hazard Warning!

Be careful when you attach the payload to the stage mounting surface.

- If a mounting screw extends through the carriage/table top, it can affect travel and damage the stage.
- Refer to the dimensions in Section 2.1. for maximum allowable thread engagement.
- Mounting Hole Cutaway:

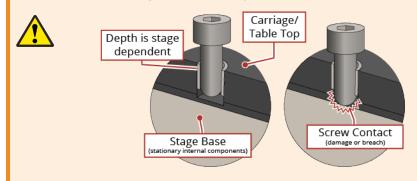

Applied loads should be symmetrically distributed whenever possible. The payload should be centered on the stage mounting surface and the entire stage should be centered on the support structure.

For a cantilevered load, first determine if it is a **Vertical**, **Horizontal**, or a **Side** cantilever system (refer to Figure 2-6).

The **Vertical** curve is for situations where the stage is mounted in a vertical orientation and the payload is mounted to the table top with its center of gravity extended outward in a direction normal to the tabletop surface. Refer to Figure 2-8 or Figure 2-9 for torque requirements on a vertical orientation.

The **Horizontal** curve assumes a horizontal stage orientation with the payload offset extending outwards along the surface of the tabletop.

The **Side** curve is for situations where the stage is mounted on its side and the offset load extends outwards in a direction normal to the tabletop surface.

Measure the cantilever length, then find the corresponding load value from Figure 2-7.



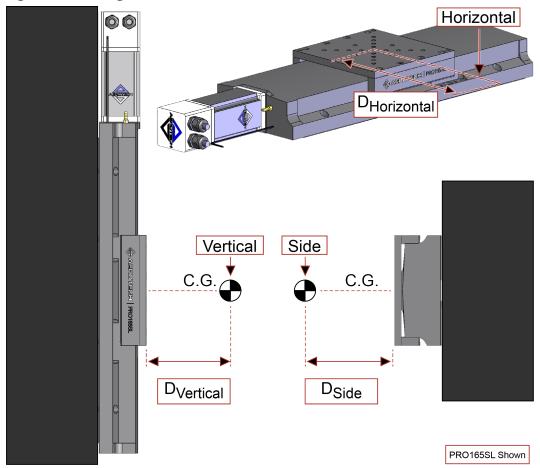


Figure 2-6: Stage Orientations

 

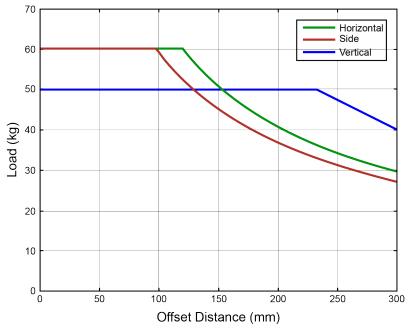


The approximate amount of torque required to turn the ball screw of PRO190SL/SLE series stages can be found from Figure 2-9 or the following equation:

Figure 2-8: Load Torque Equation

$$Torque_{REQ} = \frac{(AxialLoad) \times (LeadofScrew)}{2 \times \pi \times (Efficiency)}$$

For PRO190SL/SLE series stages, the ball screw efficiency is rated at 90% (0.90). Refer to Section 1.3. for Load Capacity specifications.

Figure 2-9: Torque Required to Turn Ball Screw in Vertical Orientation

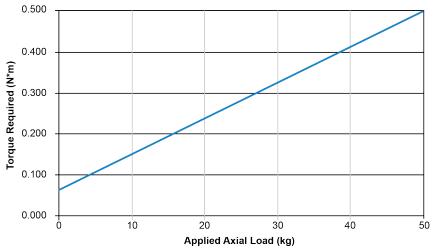

This page intentionally left blank.

Chapter 3: Electrical Installation

DANGER: Electrical Shock Hazard!

- Stage motor phase voltage levels could be hazardous live.
- Personnel are protected from hazardous voltages unless electrical interconnections, protective bonding (safety ground), or motor/stage enclosures are compromised.
- Do not connect or disconnect stage/motor interconnections while connected to a live electrical power source.
- Before you set up or do maintenance, disconnect electrical power.
- It is the responsibility of the End User/System Integrator to make sure that stages are properly connected and grounded per Engineering Standards and applicable safety requirements.
- It is the responsibility of the End User/System Integrator to configure the system drive or controller within the Aerotech motor/stage electrical and mechanical specifications.

WARNING: General Hazard Warning!



Applications that require access to the PRO190SL/SLE must be restricted to qualified and trained personnel. The system integrator or qualified installer is responsible for determining and meeting all safety and compliance requirements when they integrate the PRO190SL/SLE into a completed system. Failure to do so could expose the operator to electrical or mechanical hazards.

Electrical installation requirements will depend on the ordered product options. Installation instructions in this section are for Aerotech products equipped with standard Aerotech motors intended for use with an Aerotech motion control system. Contact Aerotech for further information on products that are otherwise configured.

Aerotech motion control systems are adjusted at the factory for optimum performance. When the PRO190SL/SLE is part of a complete Aerotech motion control system, setup should only require that you connect the stage to the appropriate drive chassis with the cables provided. Labels on the system components should indicate the appropriate connections.

If system level integration was purchased, an electrical drawing that shows the system interconnects has been supplied with the system (separate from this documentation).

The electrical wiring from the motor and encoder are integrated at the factory. Refer to the sections that follow for standard motor wiring and connector pinouts.



IMPORTANT: Refer to the controller documentation to adjust servo gains for optimum velocity and position stability.

3.1. Motor and Feedback Connectors

Stages equipped with standard motors and encoders come from the factory completely wired and assembled.



IMPORTANT: Refer to the other documentation accompanying your Aerotech equipment. Call your Aerotech representative if there are any questions on system configuration.



IMPORTANT: If you are using standard Aerotech motors and cables, motor and encoder connection adjustments are not required.

The protective ground connection of the PRO190SL/SLE provides motor frame ground protection only. Additional grounding and safety precautions are required for applications requiring access to the stage while it is energized. The System Integrator or qualified installer is responsible for determining and meeting all safety and compliance requirements necessary for the integration of this stage into the final application.

DANGER: Electrical Shock Hazard!



- The protective ground connection must be properly installed to minimize the possibility of electric shock.
- The stage controller must provide over-current and over-speed protection. Failure to do so could cause electric shock or damage to the equipment.

Table 3-1: Brushless Motor Connector Pinout

Pin	Description	Connector
Case	Shield Connection	
A1	Motor Phase A	
A2	Motor Phase B	
A3	Motor Phase C	
1	Reserved	
2	Reserved	S S S S S S S S S S S S S S S S S S S
3	Reserved	
4	Reserved	≨
5	Reserved	
A4	Frame Ground (motor protective ground)	

Table 3-2: Mating Connector Part Numbers for the Brushless Motor Connector

Mating Connector	Aerotech P/N	Third Party P/N
Backshell	ECK00656	Amphenol #17E-1726-2
Sockets [QTY. 4]	ECK00659	ITT Cannon #DM53744-6
Connector	ECK00657	ITT Cannon #DBM9W4SA197

Table 3-3:	Brushiess Motor Feedback Connector Pinout	
Pin	Description	Connector
Case	Shield Connection	
1	Reserved	
2	BMS Motors: Over-Temperature Thermistor Sensor	
2	BM Motors: Reserved	
3	5V Power Supply Input	
4	Reserved	
5	Hall Effect Sensor (Phase B)	\bigcirc
6	MRK- (Encoder Marker-)	\bigcirc
7	MRK+ (Encoder Marker+)	
8	Reserved	
9	Reserved	© 0
10	Hall Effect Sensor (Phase A)	
11	Hall Effect Sensor (Phase C)	o
12	Reserved	•
13	Reserved	0 0 0
15	Brake - (with Brake Option)	© 0
14	COS+ (Encoder Cosine+)	0 0
15	COS- (Encoder Cosine-)	0
16	Reserved	° ₀13
17	SIN+ (Encoder Sine+)	25 013
18	SIN- (Encoder Sine-)	
19	Reserved	
20	Common ground	
21	Common ground	
22	Reserved	
23	Reserved	
24	Reserved	
25	Reserved	
25	Brake + (with Brake Option)	

Table 3-3: Brushless Motor Feedback Connector Pinout

Table 3-4: Mating Connector Part Numbers for the Brushless Motor Feedback Connector

Mating Connector	Aerotech P/N	Third Party P/N
25-Socket D-Connector	ECK00300	FCI DB25S064TLF
Backshell	ECK00656	Amphenol 17E-1726-2

Pin	-E1, -E2, and -E4 Encoder Option	-E3 Encoder Option	Connector
Case	Shield Connection	Shield Connection	
1	Reserved	Reserved	
2	Reserved	Reserved	
3	+5 V power supply	+5 V power supply	
4	Reserved	Reserved	
5	Reserved	Reserved	
6	Marker-N	Clock -	
7	Marker	Clock +	
8	Reserved	Data -	14 •1
9	Reserved	Reserved	0 0
10	Reserved	Reserved	• • •
11	Reserved	Reserved	
12	Reserved	Reserved	
13	Reserved	Reserved	
14	Cosine	Reserved	e
15	Cosine-N	Reserved	0 0
16	+5 V power supply	+5 V power supply	
17	Sine	Reserved	[●] ₂₅ •13
18	Sine-N	Reserved	
19	Reserved	Data +	
20	Common ground	Common ground	
21	Common ground	Common ground	
22	Reserved	Reserved	
23	Reserved	Reserved	
24	Reserved	Reserved	
25	Reserved	Reserved	

Table 3-5: Linear Encoder Connector Pinout (-SLE only)

Table 3-6: Mating Connector Part Numbers for the Encoder Connector

Mating Connector	Aerotech P/N	Third Party P/N
25-Socket D-Connector	ECK00300	FCI DB25S064TLF
Backshell	ECK00656	Amphenol 17E-1726-2

Table 3-7: Limit Connector Wiring

Pin	Description	Limits Connector
Case	Shield Connection	
1	-LI1/-LI2 Option:5V Power Supply Limit Input	
I	-LI3 Option: 24V Power Supply Limit Input	
2	Limit Common	
3	+Limit/CW (Positive/Clockwise Travel Limit)	
4	Home Limit	•
5	-Limit/CCW (Negative/Counterclockwise Limit)	
6	Reserved	9 [•] 5
7	Common ground	
8	Reserved	
9	Reserved	


Table 3-8: Mating Connector Part Numbers for the Limit Connector

Mating Connector	Aerotech P/N	Third Party P/N
9-Pin D-Connector	ECK00340	FCI DE09S064TLF
Backshell	ECK01021	Amphenol 17E-1724-2

3.2. Motor and Feedback Wiring

Shielded cables are required for the motor and feedback connections.


Figure 3-1: **Brushless Motor and Feedback Wiring [-SL Option]**

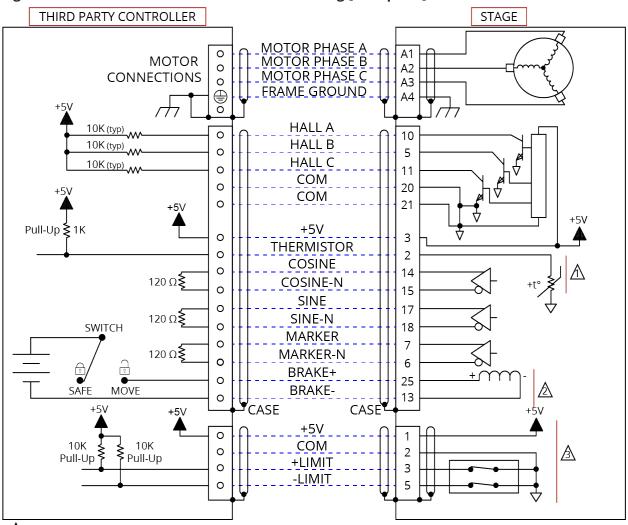

A Thermistor is only available on BMS motors.

Brake is optional.

A Limit options are factory-configured as normally closed or normally open.

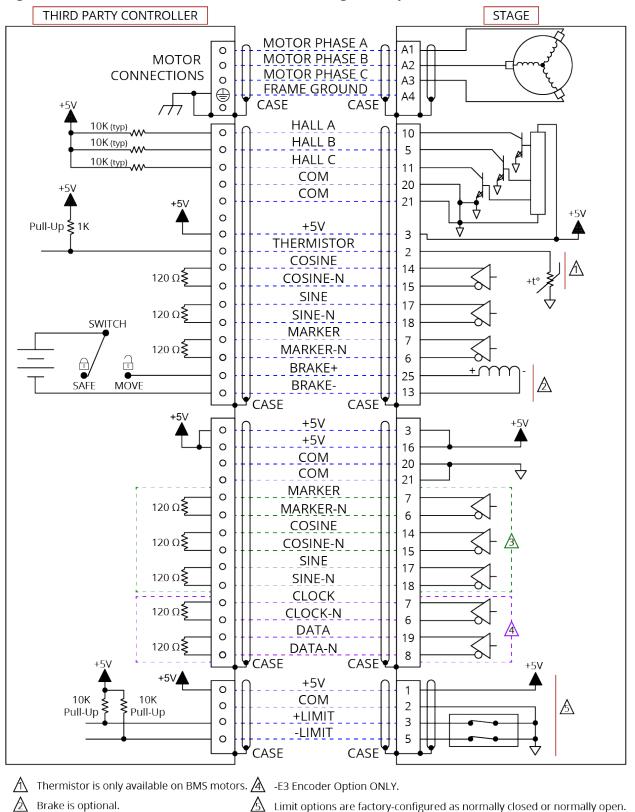



A -E1, -E2, -E4 Encoder Option ONLY.

3.3. Motor and Feedback Specifications



IMPORTANT: All 5 V supplies share one common connection within the stage.

Table 3-9: Hall-Effect Sensor Specifications

	Specification
Supply Voltage	5 V ±5%
Supply Current	50 mA
Output Type	Open Collector
Output Voltage	24 V max (pull up)
Output Current	5 mA (sinking)

Table 3-10: Thermistor Specifications (BMS Motor Options)

	Specification	
Polarity	Logic "0" (no fault)	
Polatity	Logic "1" (over-temperature fault)	
Cold Resistance ~100 Ω		
Hot Resistance ~10 K		
Note: 1K pull-up to +5V recommended.		

Table 3-11: Encoder Specifications

	Specification
Supply Voltage	5 V ±5%
Supply Current	250 mA (typical)
Output Signals	Sinusoidal Type (Incremental Encoder) : Analog: SIN+, SIN-, COS+, COS-, 1V _{pk-pk} ; Digital (RS422): MRK+, MRK- signals.
(Differential)	Digital Output (Incremental Encoder) : TTL Encoder line-driver signals; RS422/485 compatible
	Serial Output (Absolute Encoder): EnDat 2.2 with 36 bit word

Table 3-12: Rotary Encoder Resolution Specifications

Encoder Option	Fundamental Signal Period	Digital Resolution
-M1, -M2, -M5, -M6 (2500 line TTL signal)	2 µm	0.5 µm
-M3, -M4, -M7, -M8 (1000 line 1Vpp Amplified Sine signal)	5 µm	
-M3, -M4, -M7, -M8 with 1000x Interpolation ⁽¹⁾ (1000 line 1Vpp Amplified Sine signal)	5 µm	5 nm
-M3, -M4, -M7, -M8 with 4000x Interpolation ⁽¹⁾ (1000 line 1Vpp Amplified Sine signal)	5 µm	1.25 nm
1. Quadrature decoding included in interpolated resolution calculations		

Table 3-13: Linear Encoder Resolution Specifications

Encoder Option	Fundamental Signal Period	Digital Resolution
-E1	20 µm	
-E1 with x4000 Interpolation ⁽¹⁾	20 µm	5 nm
-E1 with x16000 Interpolation ⁽¹⁾	20 µm	1.25 nm
-E2	20 µm	100 nm
-E3		1 nm
-E4	20 µm	0.5 μm
1. Quadrature decoding included in interpolated	resolution calculations	

Table 3-14:Limit Switch Specifications

	-LI1 Option	-LI2 Option	-LI3 Option	
Supply Voltage	5 V	5 V	24 V	
Supply Current	25 mA			
Output Type		Open Collector		
Output Voltage	5 V	5 V	24 V	
Output Current	10 mA (sinking)	10 mA (sinking)	10 mA (sourcing)	
Output Polarity (Factory Configured)	 Normally Closed (NC) Not In Limit: Sinks current to ground (Logic "0") In Limit: High impedance (Logic "1") 	 Normally Open (NO) Not In Limit: High impedance (Logic "1") In Limit: Sinks current to ground (Logic "0") 	 Normally Closed (NC) Not In Limit: 24 V output In Limit: High impedance 	

1. If you drive the PRO190SL/SLE beyond the electrical limit, it will encounter a mechanical stop. An impact against the mechanical stop could cause damage to the stage.

2. -LI1 and -LI2 must have an external pull-up to +5 V (10 $k\Omega$ recommended).

Table 3-15: Brake Specifications

	Specification
Supply Voltage	24 VDC
Supply Current (typical)	250 mA (current required to release the brake and allow motion)

Table 3-16: PRO190SL/SLE Motor Specifications (BMS100)

		BMS100	
Performance Specifications			
Stall Torque, Continuous	N·m (oz·in)	0.56 (80.0)	
Peak Torque	N·m (oz·in)	2.26 (320.0)	
Rated Power Output, Continuous	W	133	
Electrical Specifications			
BEMF Constant (Line-Line, Max)	V _{pk} /k _{rpm}	40.0	
Continuous Current, Stall	A _{pk} (A _{rms})	2.1 (1.5)	
Peak Current, Stall	A _{pk} (A _{rms})	8.4 (5.9)	
	N·m/A _{pk}	0.270	
Torque Constant	(oz∙in/A _{pk})	(38.10)	
Torque Constant	N·m/A _{rms}	0.380	
	(oz∙in/A _{rms})	(53.90)	
Matax Constant	N·m/√W	0.076	
Motor Constant	(oz∙in/√W)	(10.74)	
Resistance, 25°C (Line-Line)	Ω	12.90	
Inductance (Line-Line)	mH	2.40	
Maximum Bus Voltage	V _{DC}	340	
Thermal Resistance	°C/W	1.35	
Number of Poles		8	

(1) All performance and electrical specifications have a tolerance of $\pm 10\%$.

(2) Values shown at 75 °C rise above a 25 °C ambient temperature, with housed motor mounted to a 250 mm x 250 mm x 6 mm aluminum heat sink.

(3) Peak torque assumes correct rms current; consult Aerotech.

(4) Torque constant and motor constant specified at stall.

(5) All Aerotech amplifiers are rated A_{pk}; use torque constant in N·m/A_{pk} when sizing.

Table 3-17: PRO190SL/SLE Motor Specifications (BM130)

		BM130
Performance Specifications		
Stall Torque, Continuous	N·m (oz·in)	1.02 (144.0)
Peak Torque	N·m (oz·in)	2.50 (361.0)
Rated Power Output, Continuous	W	333
Electrical Specifications		
BEMF Constant (Line-Line, Max)	V _{pk} /k _{rpm}	19.0
Continuous Current, Stall	A _{pk} (A _{rms})	6.9 (4.9)
Peak Current, Stall	A _{pk} (A _{rms})	17.3 (12.2)
Torque Constant	N·m/A _{pk}	0.15
	(oz∙in/A _{pk})	(20.9)
	N·m/A _{rms}	0.21
	(oz∙in/A _{rms})	(29.6)
Mater Caratert	N·m/√W	0.101
Motor Constant	(oz∙in/√W)	(14.30)
Resistance, 25°C (Line-Line)	Ω	2.00
Inductance (Line-Line)	mH	3.52
Maximum Bus Voltage	V _{DC}	340
Thermal Resistance	°C/W	1.04
Maximum Coil Temperature	°C	N/A
Number of Poles		8

(1) Performance is dependent upon heat sink configuration, system cooling conditions, and ambient temperature.

(2) All performance and electrical specifications have a tolerance of $\pm 10\%$.

(3) Values shown at 130 °C rise above a 25 °C ambient temperature, with housed motor mounted to a 305 mm x 305 mm x 12.7 mm aluminum heat sink.

(4) Values shown at 75 °C rise above a 25 °C ambient temperature, with housed motor mounted to a 250 mm x 250 mm x 6 mm aluminum heat sink.

(5) Peak torque assumes correct rms current; consult Aerotech.

(6) Torque constant and motor constant specified at stall.

3.4. Limits, Marker, and Machine Direction

Aerotech stages have both a positive and negative *Machine Direction* and a positive and negative *Programming Direction*.

Machine Direction: The machine direction is defined by how the encoder and motor are mounted and the electrical wiring connections in the stage.

Programming Direction: Your system controller defines the programming direction of the stage and is application specific. A positive programmed move may or may not agree with the machine positive direction. Refer to your programming help documentation for more information.

The home marker is located near the center of travel on stages with a linear encoder (SLE models). For stages without the linear encoder option (SL models), the marker is located in the rotary motor and will be triggered near the designated home limit.

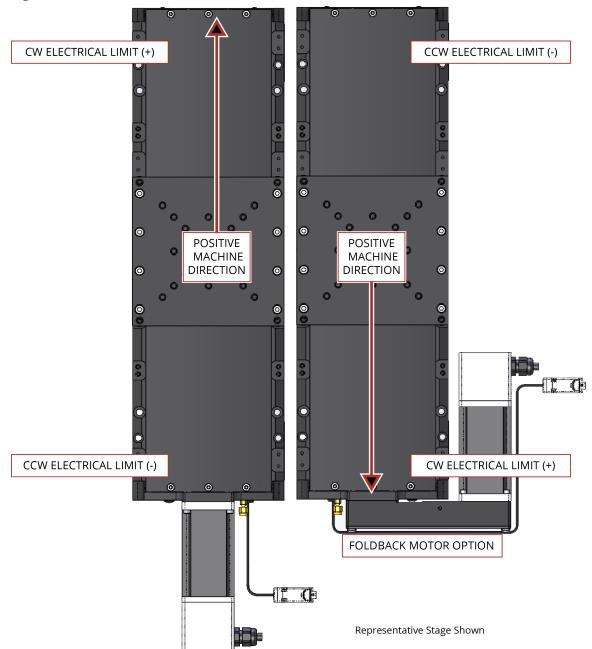
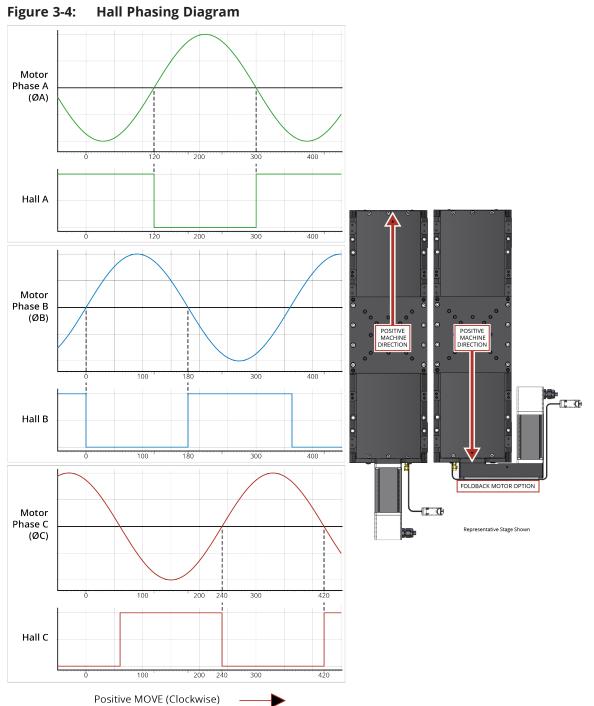


Figure 3-3: Machine Direction

3.5. Motor and Feedback Phasing

Motor phase voltage is measured relative to the virtual wye common point.




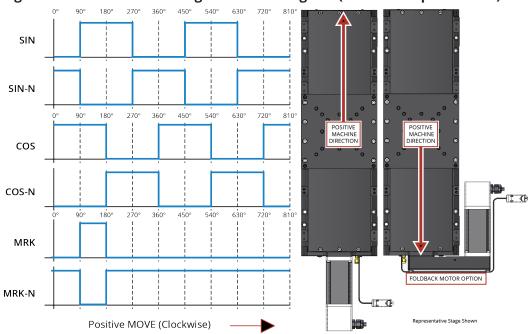


Figure 3-5: Encoder Phasing Reference Diagram (Standard/Square Wave)



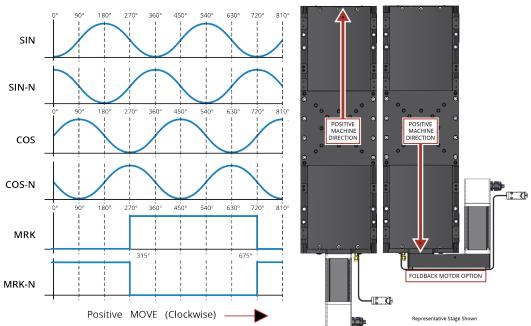

This page intentionally left blank.

Chapter 4: Maintenance



IMPORTANT: Keep the bearing area free of foreign matter and moisture or the performance and life expectancy of the stage will be reduced.

4.1. Service and Inspection Schedule

Inspect the PRO190SL/SLE at least once per month. The need for a longer or shorter inspection interval will depend on the application and conditions, such as the duty cycle, speed, and environment.

Monthly inspections should include but not be limited to:

- Visually inspect the stage and cables.
- Re-tighten loose connectors.
- Replace or repair damaged cables.
- Clean the PRO190SL/SLE and any components and cables as needed.
- Repair any damage before operating the PRO190SL/SLE.
- Inspect and perform an operational check on all safeguards and protective devices.

4.2. Cleaning and Lubrication

DANGER: **Electrical Shock Hazard!** Before you do maintenance to the equipment, disconnect the electrical power.



IMPORTANT: Wear appropriate personal protective equipment (PPE) when you use cleaning solvents or lubricants.

In general, if the stage operates in a clean environment, it should be cleaned and lubricated annually or every 500 km (whichever comes first). For stages that are operated under conditions with excessive debris, the stage should be cleaned every six months. For high-speed applications (those near max speed at a duty cycle of 50%), more frequent maintenance with standard lubricants will be required.

When you clean and/or lubricate components of the PRO190SL/SLE series stage:

- 1. Use a clean, dry, soft, lint-free cloth for cleaning.
- 2. Before you use a cleaning solvent on any part of the stage, blow away small particles and dust with clean, dry, compressed air.
- 3. Take the opportunity during the lubrication procedure to inspect the motion guides or bearings for any damage or signs of wear.
- 4. In applications that have multiple stages bolted together to form multi-axis systems, the orthogonality can be lost if the stage tables of the support stages are loosened. Precision aligned stages should not be loosened or disassembled.
- 5. We recommend that you do not disassemble the stage beyond the instructions given in this manual. Proper assembly and calibration can only be done at the factory. Contact Aerotech for more information.

For stages equipped with foldback motors, you should check the belt tension when you clean or lubricate the stage. Refer to Section 4.5.

Cleaning

Use isopropyl alcohol if you must use a solvent to clean the stage. Harsher solvents, such as acetone, could damage the plastic and rubber seals on the ball screw and bearing trucks.



WARNING: **General Hazard Warning!** Make sure that all solvent has completely evaporated before you move the stage.

Lubrication

You should only use Kluberplex BEM 34-132 as the standard lubricant for PRO190SL/SLE stages.

If the application process uses only a small portion of travel for most of the duty cycle, periodically drive the stage through full travel to redistribute the lubrication in the bearings.



IMPORTANT: During the lubrication procedure, inspect the bearings and ball screw for any damage or signs of wear.

DANGER: Mechanical Hazards!

Use extreme caution when you operate the stage without the hardcover.

- Entanglement Hazard! The side belts can present an entanglement hazard.
- Rotating Machinery! The ball screw can present a rotating machinery hazard.
- **Pinch Point!** The stage tabletop can present a pinch hazard.
- 1. Drive the stage table to one end of travel and remove power to the stage.
- 2. Remove the cover attached to the rear end plate on the side opposite of the motor (Figure 4-1).
- 3. Remove the hardcover screws (Figure 4-2).
- 4. Carefully slide the hardcover away from the stage (Figure 4-3). This can be done without removing the table.
- 5. Remove any accumulated dust or debris from the inside of the assembly.
- 6. Remove any dirty or dried lubricant from the ball screw.
- Use a clean, lint-free cloth with a side-to-side motion.
- Use a swab soaked in Isopropyl Alcohol to remove stubborn debris.
- 7. Move the stage to the opposite end of travel. If the stage has an optional brake, the stage cannot be moved by hand.
- If the stage has a brake: restore power to the stage, drive it to the desired position, then remove power
- Redo Steps 5 and 6 for any areas covered by the previous table position.
- 8. Clean the end of the ball-screw nut and wiper with a clean, lint-free cloth or swab.
- 9. Clean the linear bearing guides with a clean, lint-free cloth or swab.
- 10. Apply a thin, continuous film of lubricant to the ball-screw threads and linear bearing guides. Aerotech recommends that you use a good quality, natural bristle artist's brush.
- 11. Move the stage to the opposite end of travel. If the stage has an optional brake, the stage cannot be moved by hand.
- If the stage has a brake: restore power to the stage, drive it to the desired position, then remove power.
- Redo Steps 8 through 10 for any areas covered by the previous table position.
- 12. Refasten the hardcover.
- 13. Restore power to the stage and drive the stage table back to its original position to redistribute lubricants.


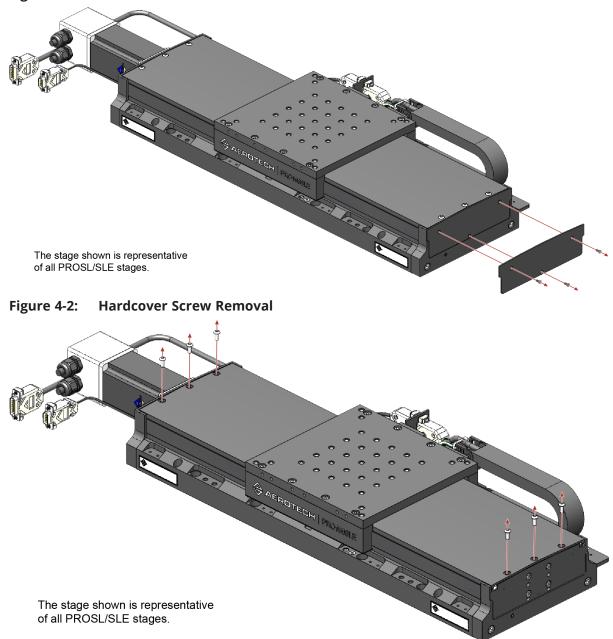


Figure 4-1: Hardcover Rear End Plate Removal

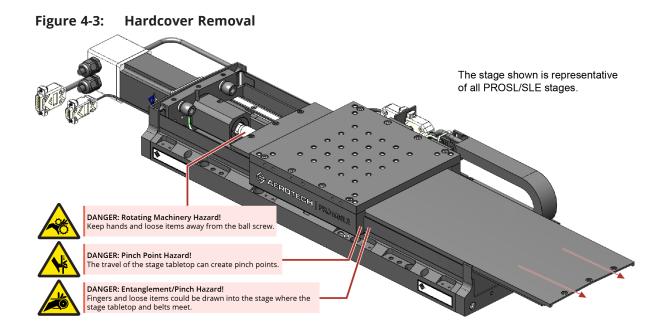

4.3. Motor Mounting

DANGER: Electrical Shock Hazard!

- Do not connect or disconnect electrical components, wires, and cables while this product is connected to a power source.
- Before you do maintenance to the equipment, disconnect the electrical power.
- Uncouple or otherwise prevent motion of motor-coupled machinery when you do service to the equipment.

Table 4-1: Hardware Requirements

Stage	Motor	Shaft Coupling	Coupling Screw	Coupling Screw
	Screw Size	Screw Size	Bit Size	Torque
PRO190SL/SLE	M4	M3	2.5 mm Hex	13 in·lbs



IMPORTANT: Use Loctite 242 or Loctite 248 on the motor and coupling adapter hardware (Figure 4-4). Loctite products are printed with an expiration date. Before use, be sure that the expiration date is legible and the product has not expired.


Rotary Motor (with Mounting Hardware)

Loctite

Mounting Hardware Detail (with Loctite applied)

If your stage is used in a vacuum or cleanroom environment, contact Aerotech.

Figure 4-4: Motor Mounting Overview

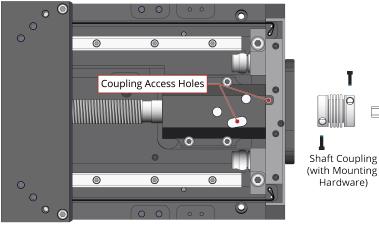


PRO Stage (Hard Cover Removed)

How to Mount a Motor


- 1. Remove the hard cover from the stage.
- 2. Locate the Shaft Coupling access holes (refer to Figure 4-4).
- 3. Test fit the Motor and Shaft Coupling to the Stage to ensure that you have access to the Shaft Coupling clamp screws.
- 4. Apply a small quantity of either Loctite 242 or Loctite 248 to motor and coupling hardware.
- 5. Attach the Shaft Coupling to the Motor shaft (refer to Figure 4-5). Refer to Table 4-1 for the correct hardware and torque requirements.


Figure 4-5: Attach the Coupling Adapter to the Motor Shaft

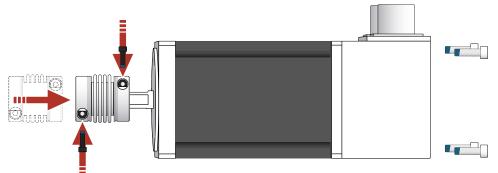

6. Attach the Motor to the Stage in the correct orientation (Figure 4-6). Use a hex wrench to ensure that the motor flange is fully seated and the hardware is tight. The motor housing prevents the use of a torque wrench.



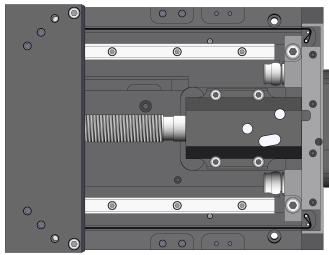

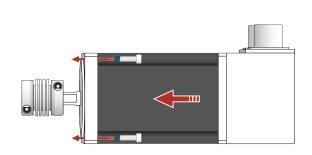

7. Tighten the Shaft Coupling to the drive screw (Figure 4-7). Refer to Table 4-1 for the correct hardware and torque requirements.

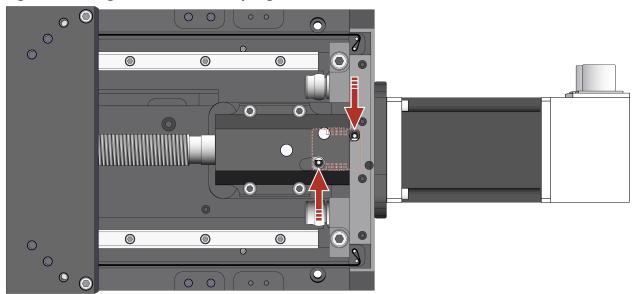


Figure 4-7: Tighten the Shaft Coupling to the Drive Screw

8. Rotate the drive screw by hand to ensure that the drive screw rotates freely.

IMPORTANT: You must reapply Loctite to the mounting hardware if the Motor or Shaft Coupling screws are removed, adjusted, loosened, or replaced.

4.4. Side Seal Belt Replacement

The side seal belts on this stage protect it from the ingress of dust and debris. Over time, the side seal belts could fray and deteriorate due to normal use. To order replacement side seal belt kits (referred to as "belt replacement kits"), refer to Table 4-2 and contact Aerotech Global Technical Support.

IMPORTANT: Side seal belt replacement should only be attempted on stages that are in working order without any damages other than the worn side seal belts. If there are other issues or inconsistencies in performance, contact Aerotech Global Technical Support.

DANGER: Electrical Shock Hazard!

• Do not connect or disconnect stage/motor interconnections while connected to a live electrical power source.

DANGER: Mechanical Hazard!

- System travel can cause crush, shear, or pinch injuries.
- Restrict access to all motor and stage parts
 - when the system moves under power (during normal operation, for example).
 - $^\circ\;$ when the system is moved manually (during the installation process or when you do maintenance, for example).

IMPORTANT: Do not disassemble the stage more than we recommended in these instructions. Further dis-assembly will result in loss of calibration and alignment.

Table 4-2: Side Seal Belt Replacement Kit Ordering Guide

Stage Travel Length	Description	Part Number
≤400 mm	Regular Length Belt Replacement Kit	MFB32959
≥500 mm	Long Length Belt Replacement Kit	MFB32960

Side Seal Belt Replacement

Required Materials:

- Belt Replacement Kit (refer to Table 4-2)
- Needle Nose Pliers
- Instant adhesive super glue (cyanoacrylate glue)
- Sharp scissors (to cut the belt to length)

Replacement Procedure:


- 1. Remove the hardcover. Clean and lubricate the stage (optional but recommended).
 - a. Refer to Section 4.2.
 - b. DO NOT replace hardcover or rear end plate after you clean and lubricate the stage.



IMPORTANT: Inspect the stage for any damage that could have caused the old side seal belts to need replacement. Do not continue with this procedure if there are signs of damage. Contact Aerotech Global Technical Support for assistance.


- 2. Remove the old side seal belt.
 - a. DO NOT pull the belt out of the stage table if the belt is intact.
 - b. Note which side of the stage holds the tension spring, this will be referred to as the rear of the stage.
 - c. Pull the belt up at the attachment pins (Figure 4-8).
 - d. Use pliers to open the spring loop that connects the spring to the side seal belt.

Figure 4-8: Belt Removal at the Attachment Pins

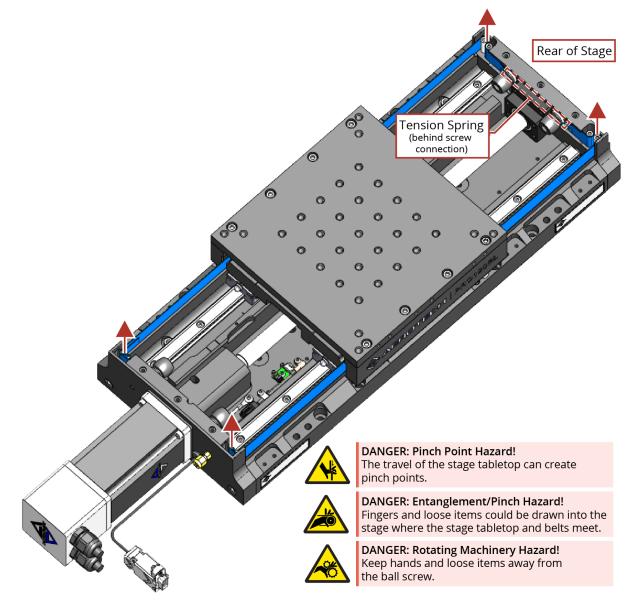


- 3. Install the new side seal belt at the rear of the stage.
 - a. If the belt is connected by the spring, use pliers to open one of the spring loops that connects the spring to the side seal belt.
 - b. Slide the spring into the stage channel before you reconnect it to the side seal belt.
 - c. Use pliers to close the spring loop around the side seal belt connection.
 - d. Slide the belt into the attachment pins at the rear of the stage.
 - e. Refer to Figure 4-9 for the correct belt/pin orientation. The belt and spring will not sit correctly until tension is applied in later steps.

Figure 4-9: Spring Location Detail

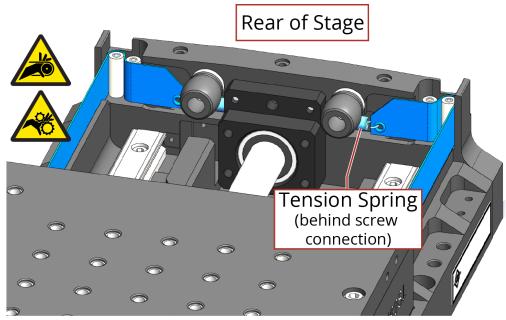

There are two methods that you can use to install the new belt through the stage table: **Pull Through Method**: Use this method if the old belt is intact and fed through the stage table. **Manual Feed Method**: Use this method if the old belt is not fed through the stage table.

- 4. (**Pull Through Method**) Install the new belt through the stage table. Refer to Figure 4-10.
 - a. Make a clean, perpendicular cut on the rear portion of one side of the old side seal belt.
 - b. Attach the loose end of the new side seal belt to the old belt with super glue.
 - i. Overlap the old belt and new belt by 10 mm.
 - ii. The new belt should be on the inside of the old belt.
 - iii. Make sure there are no twists in the glued side seal belts and that the glue connection is secure.
 - c. Carefully pull on the old side seal belt to thread the new side seal belt through the stage table.
 - d. After the new belt is pulled through the stage table, cut the off the old side seal belt from the new belt with a perpendicular cut.
 - e. Repeat steps "a" through "d" on the opposite side of the stage.

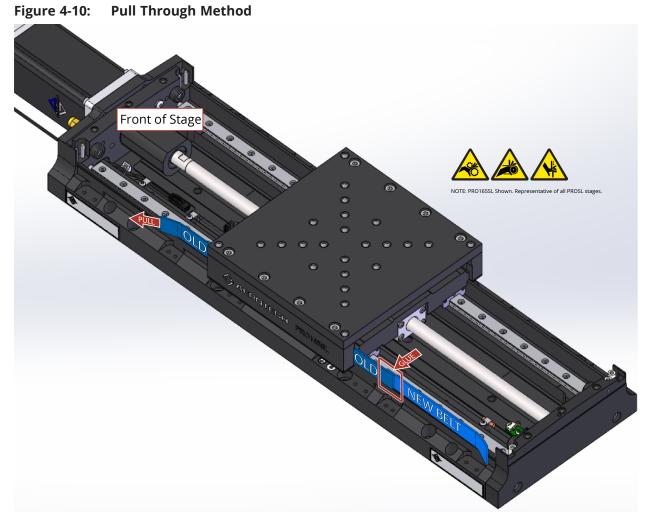

e. Repeat steps "a" through "d" on

DANGER: You will invalidate the alignment and could invalidate the calibration if you unmount a stage from its mounting surface.



IMPORTANT: A minimum of two (2) people are required to tilt the stage on its side to avoid injury to the user.



DANGER: If the stage has a brake, you will have to apply power to the stage and motor and enable them to allow this movement. Disable and disconnect the stage electrical power before you continue with this step.

- 5. (Manual Feed Method) Install the new belt through the stage table.
 - a. Carefully tilt the stage onto its side. Do not pinch any wires or damage any machined surfaces.
 - b. Manually position the stage table to provide access to the cover plate mounting screws. Refer to Figure 4-11.
 - c. Remove the cover plate.
 - d. Push the new side seal belt around the rollers. Refer to Figure 4-12.
 - e. Reinstall the cover plate and screws.
 - f. Repeat steps "a" through "e" on the opposite side of the stage.

Figure 4-11: Stage Table Cover Plate Removal



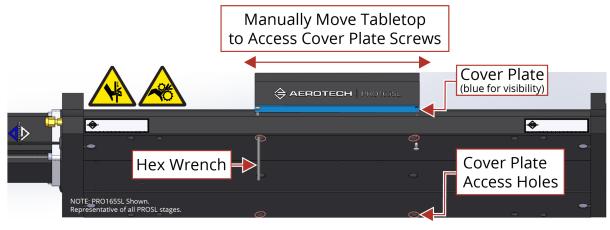


Figure 4-12: Manual Feed Method

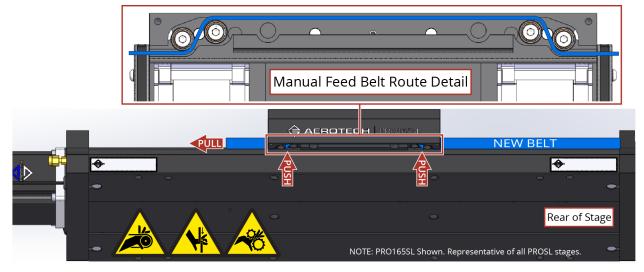

- 6. Manually pull the new belt back and forth through the table. Confirm that the side seal belt feeds through smoothly without friction or snagging. If there appears to be damages preventing successful installation, contact Aerotech Global Technical Support .
- 7. Apply equal tension to both loose ends of the new side seal belt to stretch the spring. With the spring stretched, the spring and belt assembly should look like Figure 4-9 at the rear of the stage.
- 8. While you are still holding tension in the belt, wrap the ends of the side seal belt around the front pins as shown in Figure 4-13. The side seal belt should hold the tension without glue if it is properly wrapped around the pins and there is enough spring tension.

Figure 4-13: Belt Wrap

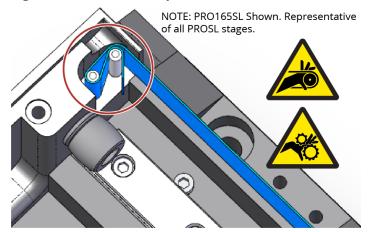


- 9. Adjust the tension on the left and right sides. Make sure that the spring is centered and stretched. Make sure that there is enough tension in the spring to satisfy all alignment requirements.
- 10. Trim the side seal belts. Leave approximatley 50 mm of overlap for adjustments and glue.



DANGER: If the stage has a brake, you will have to apply power to the stage and motor and enable them to allow this movement. Disable and disconnect the stage electrical power before you continue with this step.


- 11. With the belts secured in place and holding tension without glue, manually move the stage table through its full travel to confirm belt alignment.
 - a. The side seal belt must run parallel to the direction of travel and the belt must ride within its channel to avoid damaging the belt. Refer to Figure 4-14.
 - b. Adjust the tension and placement of the new side seal belt until it is correctly aligned.

Figure 4-14: Belt Alignment

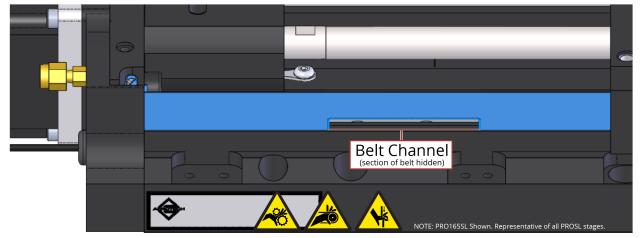

12. Once the belt is fully adjusted, trim the ends of the belt as shown in Figure 4-15.

Figure 4-15: Belt Trim

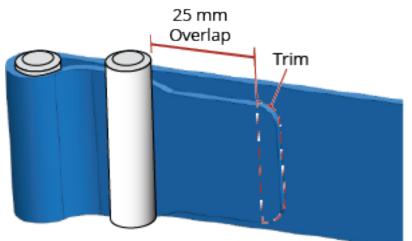

- 13. Create a permanent loop on both ends of the side seal belt by applying a small amount of super glue (cyanoacrylate glue) to the overlapping end tabs. The belt can be removed from the pins to avoid getting excess glue on stage components.
- 14. Reinstall the hardcover and rear end plate. Refer to Section 4.2.
- 15. With the stage fully reassembled, do a final test of the belt alignment. Move the stage through full travel to observe if there is interference with the hardcover. Repeat installation steps as needed to improve belt alignment.

4.5. Foldback Motor Belt Adjustment

This section applies to stages equipped with foldback motor options. On foldback stages, the motor torque is transferred to the ball screw via a timing belt. Belt tension is critical to stage performance and accuracy.

Check the belt tension when you clean or lubricate the stage. Deflection in the belt should be within $\pm 10\%$ of 2.0 mm when applying a 5 N downward force directly between the pulleys. If the deflection exceeds this value, you will need to adjust the belt tension.

You will also need to apply lubricant to the inside flanges of the pulleys if the flanges are dry. The flanges should have a thin film of lubricant to reduce belt wear as the belt contacts the flanges. Use Parker Super O-Lube (silicone-based) for standard polyurethane belts.




DANGER: Rotating Machinery Hazard!

Fingers and loose articles can get caught in the foldback belt or pulleys.

Belt Tension Adjustment Procedure


- 1. Remove power to the stage.
- 2. Remove the four mounting screws for the foldback cover (Figure 4-16).
- 3. Check that the pulleys are tight on their respective shafts (Figure 4-17).
 - a. Each pulley is held in position with two set screws.
 - b. Ensure that the set screws are tight and centered over the shaft flats.
- 4. Check the tension in the belt to determine if adjustment is necessary.
- 5. If adjustment is required, loosen (but do not remove) the mounting screws for the idler pulley mounting bracket.
- 6. Remove the M4 set screw to gain access to the tapped hole above the idler pulley mounting bracket.
- 7. Insert an M4 screw or threaded stud long enough to contact the idler pulley mounting bracket.
- 8. Use the threaded stud to drive the idler pulley mounting bracket downward and increase belt tension.
- 9. Tighten the mounting screws for the idler pulley mounting bracket.
- 10. Measure the belt deflection again and repeat the previous steps until the belt tension adjustment is complete.
- 11. Check the pulley flanges for lubrication.
- 12. Add small amounts of Parker Super O-Lube lubricant around the circumference of both pulley flanges (Figure 4-18).
- 13. Replace the foldback cover and mounting screws.
- 14. Restore power to the stage and resume normal use.



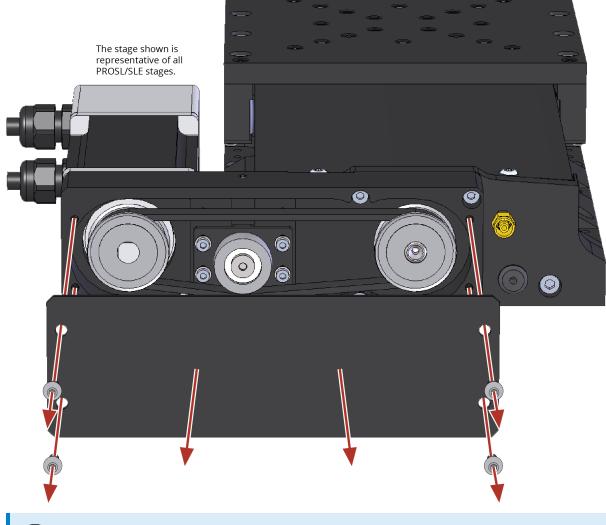

IMPORTANT: If the stage has been calibrated (-PL2 option), note the orientation of the two pulleys with regard to each other or recalibration might be required.



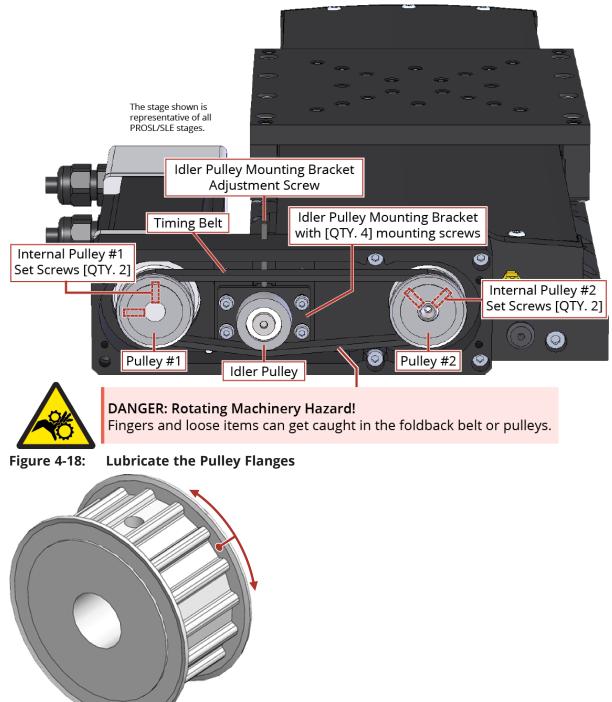

4.6. Troubleshooting

Symptom	Possible Cause and Solution		
	Shipping brackets still installed. Remove the red anodized shipping brackets.		
	Brake not released (if equipped with brake).		
Stage will not move	In Limit condition. Check limits (refer to Chapter 3: Electrical Installation) and refer to the Controller documentation for polarity and compatibility requirements (Example: voltage requirements).		
	Controller trap or fault (refer to the Controller documentation).		
Stage moves	Encoder (sine and cosine) signal connections (refer to Chapter 3: Electrical Installation and Controller documentation).		
uncontrollably	Motor Connections (refer to Chapter 3: Electrical Installation and the Controller documentation).		
Stage oscillates or	Gains misadjusted (refer to the Controller documentation).		
squeals	Encoder signals (refer to the Controller documentation).		

Appendix A: Warranty and Field Service

Aerotech, Inc. warrants its products to be free from harmful defects caused by faulty materials or poor workmanship for a minimum period of one year from date of shipment from Aerotech. Aerotech's liability is limited to replacing, repairing or issuing credit, at its option, for any products that are returned by the original purchaser during the warranty period. Aerotech makes no warranty that its products are fit for the use or purpose to which they may be put by the buyer, whether or not such use or purpose has been disclosed to Aerotech in specifications or drawings previously or subsequently provided, or whether or not Aerotech's products are specifically designed and/or manufactured for buyer's use or purpose. Aerotech's liability on any claim for loss or damage arising out of the sale, resale, or use of any of its products shall in no event exceed the selling price of the unit.

THE EXPRESS WARRANTY SET FORTH HEREIN IS IN LIEU OF AND EXCLUDES ALL OTHER WARRANTIES, EXPRESSED OR IMPLIED, BY OPERATION OF LAW OR OTHERWISE. IN NO EVENT SHALL AEROTECH BE LIABLE FOR CONSEQUENTIAL OR SPECIAL DAMAGES.

Return Products Procedure

Claims for shipment damage (evident or concealed) must be filed with the carrier by the buyer. Aerotech must be notified within thirty (30) days of shipment of incorrect material. No product may be returned, whether in warranty or out of warranty, without first obtaining approval from Aerotech. No credit will be given nor repairs made for products returned without such approval. A "Return Materials Authorization (RMA)" number must accompany any returned product(s). The RMA number may be obtained by calling an Aerotech service center or by submitting the appropriate request available on our website (www.aerotech.com). Products must be returned, prepaid, to an Aerotech service center (no C.O.D. or Collect Freight accepted). The status of any product returned later than thirty (30) days after the issuance of a return authorization number will be subject to review.

Visit Global Technical Support Portal for the location of your nearest Aerotech Service center.

Returned Product Warranty Determination

After Aerotech's examination, warranty or out-of-warranty status will be determined. If upon Aerotech's examination a warranted defect exists, then the product(s) will be repaired at no charge and shipped, prepaid, back to the buyer. If the buyer desires an expedited method of return, the product(s) will be shipped collect. Warranty repairs do not extend the original warranty period.

Fixed Fee Repairs - Products having fixed-fee pricing will require a valid purchase order or credit card particulars before any service work can begin.

All Other Repairs - After Aerotech's evaluation, the buyer shall be notified of the repair cost. At such time the buyer must issue a valid purchase order to cover the cost of the repair and freight, or authorize the product(s) to be shipped back as is, at the buyer's expense. Failure to obtain a purchase order number or approval within thirty (30) days of notification will result in the product(s) being returned as is, at the buyer's expense.

Repair work is warranted for ninety (90) days from date of shipment. Replacement components are warranted for one year from date of shipment.

Rush Service

At times, the buyer may desire to expedite a repair. Regardless of warranty or out-of-warranty status, the buyer must issue a valid purchase order to cover the added rush service cost. Rush service is subject to Aerotech's approval.

On-site Warranty Repair

If an Aerotech product cannot be made functional by telephone assistance or by sending and having the customer install replacement parts, and cannot be returned to the Aerotech service center for repair, and if Aerotech determines the problem could be warranty-related, then the following policy applies:

Aerotech will provide an on-site Field Service Representative in a reasonable amount of time, provided that the customer issues a valid purchase order to Aerotech covering all transportation and subsistence costs. For warranty field repairs, the customer will not be charged for the cost of labor and material. If service is rendered at times other than normal work periods, then special rates apply.

If during the on-site repair it is determined the problem is not warranty related, then the terms and conditions stated in the following "On-Site Non-Warranty Repair" section apply.

On-site Non-Warranty Repair

If any Aerotech product cannot be made functional by telephone assistance or purchased replacement parts, and cannot be returned to the Aerotech service center for repair, then the following field service policy applies:

Aerotech will provide an on-site Field Service Representative in a reasonable amount of time, provided that the customer issues a valid purchase order to Aerotech covering all transportation and subsistence costs and the prevailing labor cost, including travel time, necessary to complete the repair.

Service Locations

https://www.aerotech.com/contact-sales.aspx?mapState=showMap

USA, CANADA, MEXICO Aerotech, Inc. Global Headquarters **CHINA** Aerotech China Full-Service Subsidiary

TAIWAN Aerotech Taiwan Full-Service Subsidiary **UNITED KINGDOM** Aerotech United Kingdom Full-Service Subsidiary **GERMANY** Aerotech Germany Full-Service Subsidiary

Appendix B: Revision History

Revision	Description
2.01	Safety section updatedAdded Section 4.4.
2.00	Updates have been made to:Section 1.3. Basic SpecificationsSection 4.3. Motor Mounting
1.04	
1.03	Pavician changes have been archived. If you need a convert this revision, contact
1.02	Revision changes have been archived. If you need a copy of this revision, contact Aerotech Global Technical Support.
1.01	
1.00	

This page intentionally left blank.

Index

2 2006/42/EC	6	EN 60204-1 2010 EN ISO 12100 2010 Encoder Specifications EU 2015/863 eyebolts
А		_
Accuracy and Temperature Effects Accuracy of the Ballscrew acetone (caution) Altitude Ambient Temperature Attaching the Payload	18 18 50 17 17 29	F foldback Foldback Motor Belt Tension Adjustment Procedure G grease
В		н
Belt Adjustment Foldback Motor Belt Replacement Side Seal belt tension Foldback Motor Belt Tension Adjustment Procedure (Foldback Motor) BM130 BM130 Motor Specifications BMS100 BMS100 Motor Specifications Brake Specifications Brake Specifications	65 57 65 44 43 43 43 42 21	Hall-Effect Sensors Specifications Handling Humidity I Inspection Schedule isopropyl alcohol Lifting Features Limit Switch Specifications Linear Encoder Specifications Lubricant vacuum Lubrication
cleaning mounting surface	28-29	M
0		IVI

13-14 14 42 42 ns 21 50 28-29 Μ 50 Motor-Related Warnings 11 50 mounting surface cleaning 28-29 securing stage 28 23 multiaxis combinations 50 6

> Ρ packing list 13 33 part number 13-14 10 Possible Cause 68

Dimensions	
Directive 2006/42/EC	

Ε

D

	-	
Electrical Installation		
Electrical Warnings		

Cleaning

cleaning solvent

6-7 6-7 41 6 14

65

65

21

41 13 17

49 50

PRO190SL/SLE Hardware Manual

8 69

Protection Rating	17	
protective ground connection	34	W
		Warnings
R		Warranty and Field Service
Rotary Encoder Specifications	41	
S		
serial number	13-14	
shimming	28	
Side Seal Belt Replacement	57	
Side Seal Belt Replacement Kit Ordering Guide	57	
Solution	68	
Specifications	19	
BM130 Motor	44	
BMS100 Motor	43	
Brake	42	
Encoder	41	
Hall-Effect Sensors	41	
Limit Switch	42	
Linear Encoder	42	
Rotary Encoder	41	
Thermistor Specifications	41	
stabilizing stage	14	
stage		
distortion	28	
stabilizing	14	
standoffs	14	
Storage	13	
Symptom	68	
т		
Table of Contents	3	
Temperature Effects	18	
thermal expansion coefficient	18	
Thermistor Specifications	41	
torque	31	
Troubleshooting	68	
v		
vacuum guidelines	21	
vacuum lubricant (Braycote 602EF)	21	

17

Vibration